



Designation: D 1002 – 99

ACCETTATO DAL CONTROLLO	
il: 22/08/01	da:

## Standard Test Method for Apparent Shear Strength of Single-Lap-Joint Adhesively Bonded Metal Specimens by Tension Loading (Metal-to- Metal)<sup>1</sup>

This standard is issued under the fixed designation D 1002; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

*This standard has been approved for use by agencies of the Department of Defense.*

### INTRODUCTION

The accuracy of the results of strength tests of adhesive bonds will depend on the conditions under which the bonding process is carried out. Unless otherwise agreed upon by the manufacturer and the purchaser, the bonding conditions shall be prescribed by the manufacturer of the adhesive. In order to ensure that complete information is available to the individual conducting the tests, the manufacturer of the adhesive shall furnish numerical values and other specific information for each of the following variables:

(1) Procedure for preparation of surfaces prior to application of the adhesive, the cleaning and drying of metal surfaces, and special surface treatments such as sanding that are not specifically limited by the pertinent test method.

(2) Complete mixing directions for the adhesive.

(3) Conditions for application of the adhesive, including the rate of spread or thickness of film, number of coats to be applied, whether to be applied to one or both surfaces, and the conditions of drying where more than one coat is required.

(4) Assembly conditions before application of pressure, including the room temperature, relative humidity, length of time, and whether open or closed assembly is to be used.

(5) Curing conditions, including the amount of pressure to be applied, the length of time under pressure, method of applying pressure (pressure bag, press platens, etc.), heat-up rate, and the temperature of the assembly when under pressure. It should be stated whether this temperature is that of the bondline or of the atmosphere at which the assembly is to be maintained.

(6) Conditioning procedure before testing, unless a standard procedure is specified, including the length of time, temperature, and relative humidity.

A range may be prescribed for any variable by the manufacturer of the adhesive if it can be assumed by the test operator that any arbitrarily chosen value within such a range, or any combination of such values for several variables will be acceptable to both the manufacturer and the purchaser of the adhesive.

### 1. Scope

1.1 This test method covers the determination of the apparent shear strengths of adhesives for bonding metals when tested on a standard single-lap-joint specimen and under specified conditions of preparation and test.

1.2 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

<sup>1</sup> This test method is under the jurisdiction of ASTM Committee D-14 on Adhesives and is the direct responsibility of Subcommittee D14.80 on Metal Bonding Adhesives.

Current edition approved Oct. 10, 1999. Published December 1999. Originally published as D 1002 – 49 T. Last previous edition D 1002 – 94.

*1.3 The values stated in SI units are considered to be the standard. The values given in parentheses are for information only.*

### 2. Referenced Documents

#### 2.1 ASTM Standards:

A 109 Specification for Steel, Strip, Carbon, Cold-Rolled<sup>2</sup>  
A 167 Specification for Stainless and Heat-Resisting  
Chromium-Nickel Steel Plate, Sheet, and Strip<sup>2</sup>

<sup>2</sup> Annual Book of ASTM Standards, Vol 01.03.

B 36/B36M Specification for Brass Plate, Sheet, Strip, and Rolled Bar<sup>3</sup>  
 B 152 Specification for Copper Sheet, Strip, Plate, and Rolled Bar<sup>3</sup>  
 B 209 Specification for Aluminum and Aluminum-Alloy Sheet and Plate<sup>4</sup>  
 B 265 Specification for Titanium and Titanium Alloy Strip, Sheet, and Plate<sup>5</sup>  
 D 907 Terminology of Adhesives<sup>6</sup>  
 D 4896 Guide for Use of Adhesive-Bonded Single Lap-Joint Specimen Test Results<sup>6</sup>  
 E 4 Practices for Force Verification of Testing Machines<sup>7</sup>

### 3. Terminology

3.1 *Definitions*—Many terms in this test method are defined in Terminology D 907.

### 4. Significance and Use

4.1 This test method is primarily comparative. However, it does have application as a discriminator in determining variations in adherend surface preparation parameters and adhesive environmental durability. The test method has found applications in controlling surface preparations, primer, and adhesive systems for determining strength properties of tested systems.

4.2 The misuse of strength values obtained from this test method as design-allowable stress values for structural joints could lead to product failure, property damage, and human injury. The apparent shear strength of an adhesive obtained from a given small single-lap specimen may differ from that obtained from a joint made with different adherends or by a different bonding process. The normal variation of temperature and moisture in the service environment causes the adherends and the adhesive to swell or shrink. The adherends and adhesive are likely to have different thermal and moisture coefficients of expansion.

4.3 Even in small specimens, short-term environmental changes may induce internal stresses or chemical changes in the adhesive that permanently affect the apparent strength and other mechanical properties of the adhesive. The problem of predicting joint behavior in a changing environment is even more difficult if a different type of adherend is used in a larger structural joint than was used in the small specimen.

4.4 The apparent shear strength measured with a single-lap specimen is not suitable for determining design-allowable stresses for designing structural joints that differ in any manner from the joints tested without thorough analysis and understanding of the joint and adhesive behaviors.

4.5 Single-lap tests may be used for comparing and selecting adhesives or bonding processes for susceptibility to fatigue and environmental changes, but such comparisons must be made with great caution since different adhesives may respond differently in different joints. See Guide D 4896 for further discussion of the concepts relative to interpretation of adhesive-bonded single-lap-joints.

<sup>3</sup> Annual Book of ASTM Standards, Vol 02.01.

<sup>4</sup> Annual Book of ASTM Standards, Vol 02.02.

<sup>5</sup> Annual Book of ASTM Standards, Vol 02.04.

<sup>6</sup> Annual Book of ASTM Standards, Vol 15.06.

<sup>7</sup> Annual Book of ASTM Standards, Vol 03.01.

### 5. Apparatus

5.1 The testing machine shall conform to the requirements of Practice E 4. The testing machine shall be so selected that the breaking load of the specimens falls between 15 and 85 perc

ent of the full-scale capacity. The machine shall be capable of maintaining a rate of loading of 80 to 100 kg/cm<sup>2</sup> (1200 to 1400 psi)/min, or, if the rate is dependent on crosshead motion, the machine should be set to approach this rate of loading, approximately 0.05 in./min. It shall be provided with a suitable pair of self-aligning grips to hold the specimen. It is recommended that the jaws of these grips shall engage the outer 25 mm (1 in.) of each end of the test specimen firmly.

5.2 The grips and attachments shall be so constructed that they will move into alignment with the test specimen as soon as the load is applied, so that the long axis of the test specimen will coincide with the direction of the applied pull through the center line of the grip assembly.

5.3 The length of overlap of the specimen may be varied where necessary. The length of the specimen in the jaws, however, must not be varied. The distance from the end of the lap to the end of the jaws should be 63 mm (2½ in.) in all tests.

### 6. Test Specimens

6.1 Test specimens shall conform to the form and dimensions shown in Fig. 1. These shall be cut from test panels prepared as prescribed in Section 7. The recommended thickness of the sheets is 1.62 ± 0.125 mm (0.064 ± 0.005 in.). The recommended length of overlap for most metals of 1.62 mm (0.064 in.) in thickness is 12.7 ± 0.25 mm (0.5 ± 0.01 in.).

6.2 Since it is undesirable to exceed the yield point of the metal in tension during test, the permissible length of overlap in the specimen will vary with the thickness and type of metal, and on the general level of strength of the adhesive being investigated. The maximum permissible length may be computed from the following relationship:

$$L = F_{Ty} t / \tau \quad (1)$$

where:

$L$  = length of overlap, in.,

$t$  = thickness of metal, in.,

$F_{Ty}$  = yield point of metal (or the stress at proportional limit), psi, and

$\tau$  = 150 percent of the estimated average shear strength in adhesive bond, psi.

6.3 A variation in thickness of the metal, and the length of overlap, will likely influence the test values and make direct comparison of data questionable. For this reason, in comparative or specification tests, the thickness should preferably be

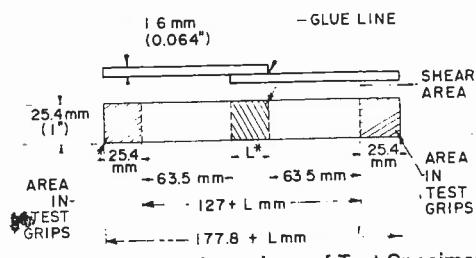


FIG. 1 Form and Dimensions of Test Specimen

$1.62 \pm 0.125$  mm ( $0.064 \pm 0.005$  in.) and the length of overlap should preferably be  $12.7 \pm 0.25$  mm ( $0.5 \pm 0.01$  in.), or not in excess of the value computed in 6.2. For development tests values could be different, but should then be constant.

6.4 The following grades of metal are recommended for the test specimens:

Metal	ASTM Designation
Brass	B 36, Alloy 8
Copper	B 152, Type A
Aluminum	B 209, Alloy 2024, T3 temper
Steel	A 109, Grade 2
Corrosion-resisting steel	A 167, Type 302
Titanium	B 265

6.5 At least 30 specimens shall be tested, representing at least four different joints. However, if statistical analysis of data and variance is employed, it should be possible to reduce this number.

## 7. Preparation of Test Joints

7.1 It is recommended that test specimens be made up in multiples of at least five specimens, and then cut into individual test specimens (Note 1), Fig. 2 and Fig. 3. Cut sheets of the metals prescribed in 6.1 and 6.4 to suitable size. All edges of the metal panels and specimens which will be within (or which will bound) the lap joints shall be machined true (without burrs or bevels and at right angles to faces) and smooth (rms 160 max) before the panels are surface-treated and bonded. Clean and dry the sheets carefully, according to the procedure prescribed by the manufacturer of the adhesive, and assemble in pairs. Prepare and apply the adhesive according to the recommendations of the manufacturer of the adhesive. Apply the adhesive to a sufficient length in the area across the end of one or both metal sheets so that the adhesive will

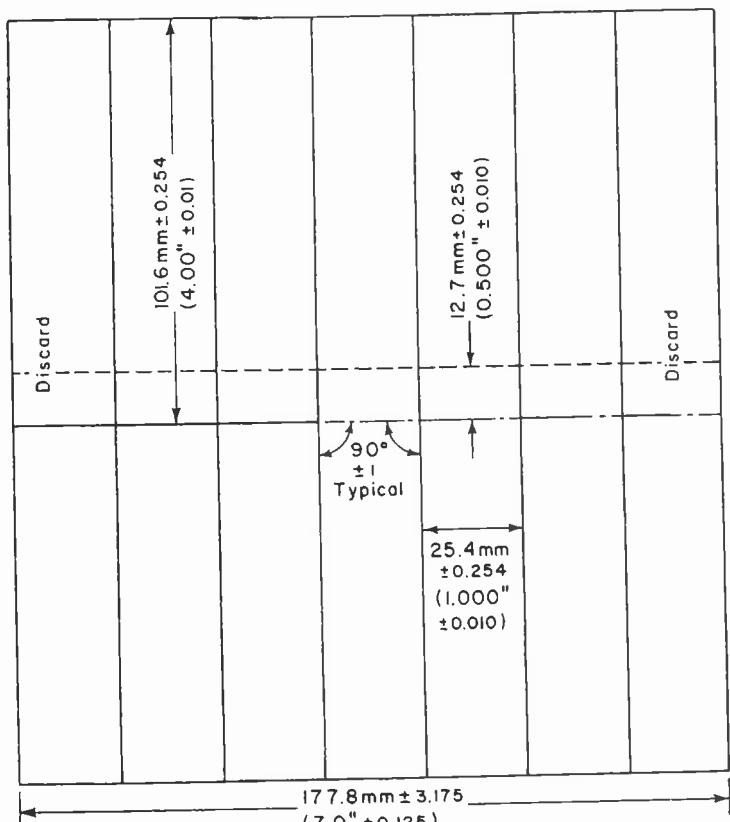


FIG. 2 Standard Test Panel

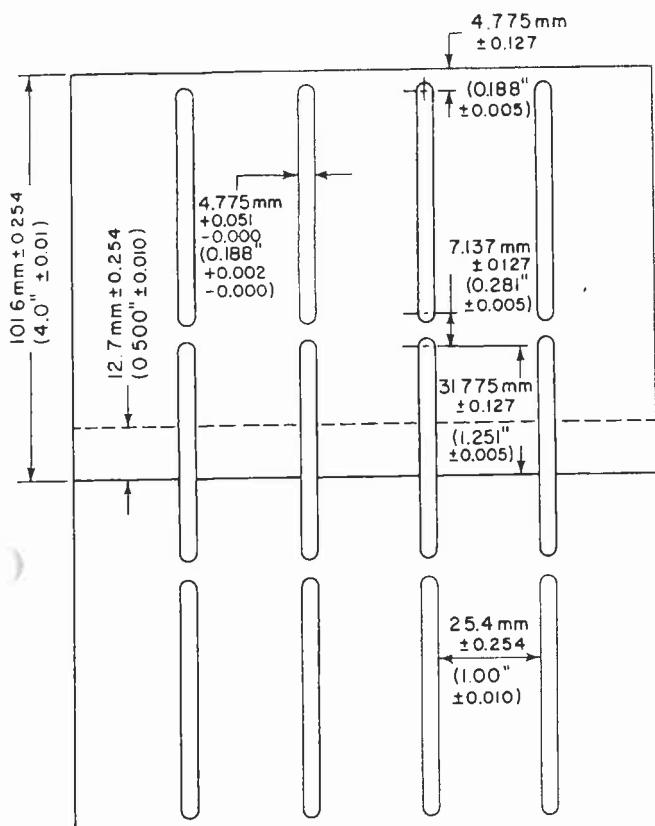


FIG. 3 Optional Panel for Acceptance Tests Only

cover a space approximately 6 mm ( $\frac{1}{4}$  in.) longer than the overlap as selected in Section 6. Assemble the sheets so that they will be held rigidly so that the length of the overlap will be controlled, as indicated in Section 6, within 0.25 mm ( $\pm 0.01$  in.), and the adhesive allowed to cure as prescribed by the manufacturer of the adhesive.

NOTE 1—Bonding specimens in multiple panels is believed to give more representative specimens. However, individual specimens may be prepared if agreeable to the supplier or the purchaser of the adhesive.

## 8. Preparation of Test Specimens

8.1 Cut the test specimens, as shown in Fig. 1, from the panels, Figs. 2 and 3. Perform the cutting operation so as to avoid overheating or mechanical damage to the joints (Note 2). For final preparation trim panel area according to Fig. 2. Measure the width of the specimen and the length of the overlap to the nearest 0.25 mm (0.01 in.) to determine the shear area.

NOTE 2—A five-tooth, typesetter's circular saw has been found suitable for such purposes.

## 9. Procedure

9.1 Test the specimens, prepared as prescribed in Section 8, as soon after preparation as possible. The manufacturer of the

adhesive may, however, prescribe a definite period of conditioning under specific conditions before testing.

9.2 Place the specimens in the grips of the testing machine so that the outer 25 mm (1 in.) of each end are in contact with the jaws (see 5.3) and so that the long axis of the test specimen coincides with the direction of applied pull through the center line of the grip assembly. Apply the loading immediately to the specimen at the rate of 80 to 100 kg/cm<sup>2</sup> (1200 to 1400 psi) of the shear area per min. Continue the load to failure. This rate of loading will be approximated by a free crosshead speed of 1.3 mm (0.05 in.)/min.

## 10. Calculations

10.1 Record the load at failure and the nature and amount of this failure (cohesion in adhesive or metal, or adhesion) for each specimen. Express all failing loads in kilograms per square centimeter (pounds per square inch) of shear area, calculated to the nearest 0.06 cm<sup>2</sup> (0.01 in.<sup>2</sup>).

## 11. Report

11.1 Report the following:

11.1.1 Complete identification of the adhesive tested, including type, source, date manufactured, manufacturers' code numbers, form, etc.,

11.1.2 Complete identification of the metal used, its thickness, and the method of cleaning and preparing its surfaces prior to bonding,

11.1.3 Application and bonding conditions used in preparing specimens,

11.1.4 Average thickness of adhesive layer after formation of the joint within 0.001 in. (0.025 mm). The method of obtaining the thickness of the adhesive layer shall be described including procedure, location of measurements, and range of measurements.

11.1.5 Length of overlap used,

11.1.6 Conditioning procedure used for specimens prior to testing,

11.1.7 Number of specimens tested,

11.1.8 Number of joints represented and type of joint if other than single overlap,

11.1.9 Maximum, minimum, and average values for the failing load, and

11.1.10 The nature of the failure, including the average estimated percentages of failure in the cohesion of the adhesive, contact failure, and adhesion to the metal.

## 12. Precision and Bias

12.1 The precision and bias statement for this test method has not been determined yet. Archival and round-robin information is being reviewed, and the results are expected by September 2004.

## 13. Keywords

13.1 adhesives; metal-to-metal; shear strength; single-lap joint; tension loading

 D 1002

*The American Society for Testing and Materials takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.*

*This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, 100 Barr Harbor Drive, West Conshohocken, PA 19428.*

*This standard is copyrighted by ASTM, 100 Barr Harbor Drive, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or [service@astm.org](mailto:service@astm.org) (e-mail); or through the ASTM website (<http://www.astm.org>).*